	UNIVERSITI 1	TEKNOLOGI MALAYSIA
	BORANG PENG	GESAHAN STATUS TESIS ^υ
JUDUL : A C	ASE STUDY ON C	CONCRETE PROBLEMS IN UTM
	SESI P	ENGAJIAN : <u>2005/2006</u>
Saya	ABDUL AZIZ	JULKARNAIN
		(HURUF BESAR)
		a/ Doktor Falsafah)* ini disimpan di perpustakaan rat-syarat kegunaan seperti berikut :
		Teknologi Malaysia. gi Malaysia dibenarkan membuat salinan untuk tujuan
3. Perpustal	kaan dibenarkan membua	at salinan tesis ini sebagai bahan pertukaran antara institusi
pengajian 4. ** Sila ta	n tinggi. andakan (√).	
	SULIT	(Mengandungi maklumat yang berdarjah keselamatan atau kepentingan Malaysia seperti yang termaktub di dalam AKTA RAHSIA RASMI 1972)
	TERHAD	(Mengandungi maklumat yang berdarjah keselamatan atau kepentingan Malaysia seperti yang termaktub di dalam AKTA RAHSIA RASMI 1972)
	TIDAK TERHA	AD
		Disahkan oleh
(TANDATA	ANGAN PENULIS)	(TANDATANGAN PENYELIA)
Alamat Tetap LOT 57, KG. KB	: TPAVAN	
	GA PATUMA 2, 88100	P.M DR. ABDUL RAHMAN MOHD SAM Nama Penyelia
Tarikh : 05 MA	AY 2006	Tarikh :
CATATAN :	* Potong yang be	rkenaan

 ** Jika tesis ini SULIT atatu TERHAD, sila lampirkan surat daripada pihak berkuasa/organisasi berkenaan dengan menyatakan sekali sebab dan tempoh tesis ini perlu dikelaskan sebagai SULIT atau TERHAD
v Tesis dimaksudkan sebagai tesis bagi Ijazah Doktor Falsafah dan Sarjana

secara penyelidikan, atau disertasi bagi pengajian secara kerja kursus dan penyelidikan, atau Laporan Projek Sarjana Muda (PSM) "I declare that I have read through this project report and to my opinion this report is adequate in term of scope and quality for the purpose of awarding the degree of Master of Engineering (Civil – Structure)".

Signature	:	
Name of Supervisor	:	
Date	:	

A CASE STUDY ON CONCRETE PROBLEMS IN UTM

ABDUL AZIZ JULKARNAIN

A project report submitted in partial fulfilment of the requirement for the award of the degree of Master of Engineering (Civil – Structure)

> Faculty of Civil Engineering Universiti Teknologi Malaysia

> > MAY, 2006

I declare that this project report entitled 'A Case Study on Concrete Problems in UTM' is the result of my own research except as cited in the references. The project report has not been accepted for any degree and is not concurrently submitted in candidature of any other degree.

Signature	:	
Name	:	
Date	:	

This study is especially dedicated to my beloved Mommy and Daddy Brothers and Sisters, Beloved *Dear*, for everlasting love, care, and supports.....

ACKNOWLEDGMENT

With the accomplishment of this project, the author would like to extend the special and greatest gratitude to the project supervisor, Assoc. Prof. Dr. Abdul Rahman Mohd. Sam of Faculty of Civil Engineering, Universiti Teknologi Malaysia for his enthusiastic effort and concern. With his invaluable advice, guidance and encouragement, the author was able to complete this project.

The author gratefully acknowledges the cooperation of En. Mohd. Faizal Wakiman, Pn. Aidalizah, Pn. Meery Zailina, En. Khairuddin Maidin and friends during the data collection.

Deepest thanks to the author's family especially for their encouragement and support in life. Without them the author would not be able to complete the project.

ABSTRACT

This Project was conducted to study the types of concrete problems and its basic category in UTM. The required information was gathered by conducting visual inspection to selected areas and buildings. Interviews with Pejabat Harta Bina and building custodian had made this survey easier when the required information available in their archive. By using fundamental knowledge in relating symptoms of defects to its causes, defects list and weightage of concrete problems based on percentage according to their basic category of cause i.e. Design Deficiency, Material Defect, Construction Error and Maintenance Defect, has been able to be developed and derived. The relationships were determined using approximate approach i.e. deducing initial failure hypotheses (IFH). From this survey, apparently based on the percentage, Design Deficiency has contributed the highest numbers of defective concrete in the survey, followed by Material Defect, Construction Error and Maintenance Defect, by, 34%, 30%, 26% and 10%, respectively. These data are further utilised by relating its causes to durability of the concrete structures in UTM. The results show that, regardless the root of reasons why concrete has became problematic; it has, for sure, given profound impact on the durability of concrete. For instance, crackings induced by design deficiency or by construction error at least permit access and ingress to aggressive agents to propagate deterioration process i.e. corrosion of reinforcement. With these information, it is hoped that the established platform on gathered information about concrete problems in UTM, may able to set forth preliminary reference for any purposes in relating to the above subject. Therefore, preventive measures can be set forth to avoid repetitive concrete problems in UTM in years to come.

ABSTRAK

Projek ini disediakan untuk mengkaji masalah konkrit dan kategorinya di UTM. Untuk mencapai objektif kajian, maklumat yang diperlukan diperolehi melalui kaedah pengamatan dan sesi-sesi temuramah dengan pihak-pihak yang berkaitan yang telah banyak membantu dalam penyiapan laporan projek ini. Dengan menggunakan pengetahuan asas dalam mengenal pasti simptom-simptom kegagalan konkrit dan penyebabnya, senarai masalah konkrit dan peratusan berbanding jumlah kegagalan berdasarkan kategori-kategori am iaitu 'kegagalan rekabentuk', bahan', 'kesilapan pembinaan' 'kelemahan 'kegagalan dan kerja-kerja penyelenggaraan'; telah dapat ditentukan dengan menggunakan kaedah hipotesis awal kegagalan. Berdasarkan kajian, kategori 'kegagalan rekabentuk' telah menyumbangkan peratusan yang tertinggi berbanding kategori-kategori lain sebanyak 34% daripada keseluruhan data yang telah direkodkan. Ini diikuti dengan kategori 'kegagalan bahan', kategori 'kesilapan pembinaan' dan kategori 'kelemahan kerja-kerja penyelenggaraan' dengan peratusan masing-masing sebanyak 30%, 26% dan 10%. Data-data ini seterusnya dianalisa dengan mengkaitkannya dengan kebolehtahanlasakan konkrit di UTM. Data yang diperolehi menunjukkan, tanpa mengira kategori penyebab masalah, ia sudah pasti akan mempengaruhi kebolehtahanlasakan konkrit. Contohnya, keretakan yang disebabkan kegagalan pada rekabentuk dan teknik pembinaan yang salah akan memberikan ruang untuk agen-agen agresif menyebabkan proses kemerosotan kualiti konkrit terutamanya pengaratan pada tetulang konkrit. Dengan maklumat-maklumat ini, diharapkan ia dapat menyediakan satu platform pengumpulan masalah-masalah konkrit di UTM dan juga sebagai rujukan awal untuk tujuan berkaitan masalah tersebut. Oleh itu, langkah-langkah pencegahan dapat ditentukan supaya masalahmasalah konkrit di UTM tidak akan berulang di masa akan datang.

TABLE OF CONTENTS

CHAPTER DESCRIPTION

TITLE	i
STUDENT'S DECLARATION	ii
DEDICATION	iii
ACKNOWLEDGEMENT	iv
ABSTRACT	V
ABSTRAK	vi
TABLE OF CONTENTS	vii
LIST OF TABLES	xi
LIST OF FIGURES	xii
LIST OF APPENDICES	xvii

1 INTRODUCTION

1.1	Introduction	1
1.2	Research Background	2
1.3	Research Objectives	5
1.4	Scopes of Research	5

2 LITERATURE REVIEW

2.1	Introdu	uction	7
2.2	Durabi	ility	8
	2.2.1	Environmental and Usage Factors	10

PAGE

		2.2.1.1 Abrasion and Erosion	10
		2.2.1.2 Climatic Condition	11
		2.2.1.3 Atmospheric Pollution	11
		2.2.1.4 Biological Attack	11
		2.2.1.5 Chemical Attack	11
	2.2.2	Compositional and Production Factors	12
		2.2.2.1 Types of Cement and Cement Content	13
		2.2.2.2 Types of Aggregate	15
		2.2.2.3 Degree of Compaction and Air Content	16
		2.2.2.4 Water/Cement Ratio (w/c) and Curing	17
2.3	Quality	y Control	19
2.4	Disting	guishing Durability Problem and Design Problem	20
	2.4.1	Determining Structural Integrity	21
	2.4.2	Pre-Determining of Structural Integrity	23
		2.4.2.1 Inadequate Structural Design	23
		2.4.2.2 Poor Design Details	24
	2.4.3	Types of Concrete Cracks, Causes of Cracks,	25
		Remedial Works and Time of Appearance	
2.5	Non-D	estructive Tests	27
	2.5.1	Covermeter	28
		2.5.1.1 Reliability, Limitations and Applications	29
	2.5.2	Rebound Hammer Method	30
	2.5.3	Ultrasonic Pulse Velocity Test (UPV)	31
		DLOGY	
3.1	Introdu		34
3.2		ds in Gathering Raw Data	35
	3.2.1	Site Visits	35
	3.2.2	Interviews	38
3.3	Metho	ds in Interpreting and Analysis of Raw Data	39

RESULTS AND FINDINGS 4

3

4.1	Introduction	43	3

39

4.2	Comm	on Defects and Their Causes	44
	4.2.1	List of Defects Through Findings	45

5 ANALYSIS OF RESULTS

5.1 Introduction

55

5.2	Design	55	
	5.2.1	Predictable Design Deficiencies	56
	5.2.2	Unpredictable Design Deficiencies	63
5.3	Materi	al Defects	72
5.4	Constr	ruction Errors	82
5.5	Mainte	enance Defects	93

6 DISCUSSION OF FINDINGS

6.1	Introdu	98		
6.2	Concrete Problems vs. Durability of Concrete			
6.3	Design	Deficiencies	101	
6.4	Materia	al Defects	103	
6.5	Constru	Construction Errors		
	6.5.1	Adding Water to Concrete	105	
	6.5.2	Improper Alignment of Formwork	105	
	6.5.3	Improper Consolidation	105	
	6.5.4	Improper Curing	106	
	6.5.5	Improper Location of Reinforcing Steel	106	
	6.5.6	Movement of Formwork	107	
	6.5.7	Premature Removal of Shores or Reshores	107	
	6.5.8	Settling of the Concrete	107	
	6.5.9	Settling of the Subgrade	107	
	6.5.10	Vibration of Freshly Placed Concrete	108	
	6.5.11	Improper Finishing of Flatwork	108	
6.6	Mainte	nance Defects	109	
	6.6.1	Prevention of Differential Settlement or Slope	110	
		Subsidence		
	6.6.2	Prevention of Staining on Concrete Surface	110	

	6.6.3	Building Maintenance Manual/Log Book	112	
6.7	Corros	Corrosion of Reinforcement		
	6.7.1	Protection of Steel in Concrete	117	
	6.7.2	Mechanism of Corrosion and Corrosion Protection	117	
	6.7.3	Carbonation of Concrete	118	
	6.7.4	Chloride Attack	119	
	6.7.5	Corrosion of Reinforcement	120	
	6.7.6	Preventive Measures	122	

7 CONCLUSIONS AND RECOMMENDATIONS

7.1	Introduction	124
7.2	Summary of the Findings	124
7.3	Conclusions	125
7.4	Recommendation for Future Study	126

REFERENCES

APPENDICES

Х

128

130

LIST OF TABLES

TABLE NO.	TITLE	PAGE
2.1	Table adapted from Table 6.1 from BS8110: Part 1.	13
2.2	Typical composition of Ordinary Portland Cement.	15
2.3	Classification of intrinsic cracks.	26
3.1	Visual examination of concrete problems: items for	36
	checklist.	
4.1	List of defects identified through survey.	45
4.2	Data used to develop chart in Figure 4.1.	52
4.3	Data for Academic Buildings aged more than 10 years.	53
4.4	Data for Academic Buildings aged less than 10 years.	53
4.5	Data for Residential Buildings aged more than 10	53
	years.	
4.6	Data for Residential Buildings aged less than 10 years.	54
6.1	Vibration limits for freshly placed concrete.	108
6.2	Conditions and features of reinforcement corrosion.	115
6.3	The manifestation of reinforcement corrosion.	117

LIST OF FIGURES

FIGURE NO.	TITLE	PAGE
1.1	Figure depicts concrete have been severely eroded and	3
	start spalling.	
1.2	Figure depicts pathways slab transversely cracking.	4
1.3	Figure depicts apron slab start cracking and surface is	4
	abraded.	
2.1	Biological Attack on concrete.	12
2.2	Water / cement ratio 0.3.	17
2.3	Water / cement ratio 0.5.	17
2.4	Water / cement ratio 0.8.	18
2.5	Some typical crack types: (a) reinforcement corrosion;	21
	(b) plastic shrinkage; (c) sulphate attack; (d)	
	alkali/aggregate reaction.	
2.6	NDT was carried out to check the structural integrity of	22
	the beam by getting essential parameters such as cover	
	thickness, numbers of reinforcement, size of	
	reinforcement, location of reinforcement and stirrups.	
2.7	NDT was carried out to check the structural integrity of	23
	the beam by getting essential parameters such as cover	
	thickness, numbers of reinforcement, size of	
	reinforcement, location of reinforcement and stirrups.	
2.8	Schematic representation of the various types of	25
	cracking which can occur in concrete (see Table 2.3).	
2.9	Typical simple covermeter .	28
2.10	Typical simple covermeter circuitry.	29

2.11	Most common used rebound hammer, Schmidt	30
	Hammer.	
2.12	The Schmidt Hammer in use.	31
2.13	Commonly used UPV, 'PUNDIT'.	32
2.14	Placement of pundit test equipment.	33
3.1	Pejabat Harta Bina.	38
3.2	Reinforcement corrosion is related to the pattern of	41
	distress (longitudinal cracking) along prop for	
	Monsoon Drain.	
3.3	Illustration of Methodology.	42
4.1	Percentage of Defects based on main category and age.	51
5.1	Combination of shear and flexural cracks clearly	57
	shown.	
5.2	Longitudinal also detected on the soffit of the beam.	58
	(enlarged view).	
5.3	Combination of shear and longitudinal cracks.	58
5.4	Typical pattern of cracks on slab in residential	59
	buildings.	
5.5	Staining on wall due to leakage.	60
5.6	Staining on wall due to leakage.	60
5.7	Watermarks at intersection joints of columns and	61
	beams.	
5.8	Watermarks at intersection joints of columns and	61
	beams. Seems stalactite (Calcium salts) has been	
	formed.	
5.9	Typical arrangement of reinforcing bars at intersection.	62
5.10	The building seems slipping on one side based on the	63
	cracks appeared.	
5.11	Pusat Komposit (Block P23).	64
5.12	Cracks appeared on beam.	65
5.13	Diagonal distortion cracking caused by differential	66
	foundation settlement due to hard/soft contact pressure.	
5.14	Differential settlement of external stack wall resulting	66

	from basement extending over part plan area only.	
5.15	Settlement of internal wall due to soft spot caused by	67
	migrating swallow hole.	
5.16	Front view of Pusat Komposit.	68
5.17	Cracks on beam (zoomed-in view).	69
5.18	Cracks on column (enlarged view).	69
5.19	Retaining wall near Pusat Komposit (Block P23).	70
5.20	Slope at Block M47.	70
5.21	Cracks on wall, Block M47.	71
5.22	Cracks on apron slab, Block M47.	71
5.23	Cracks on drain wall, Block M47.	72
5.24	Monsoon drain at Kolej 16.	74
5.25	Algae resided in the prop and longitudinal cracks are	74
	visible.	
5.26	Stain (rust-colored) implied corrosion of reinforcement	75
	had occurred.	
5.27	Longitudinal stain at the bottom of beam.	76
5.28	Cracks on the perimeter beam.	76
5.29	Retaining wall adjacent to Pusat Komposit.	77
5.30	White deposits show formation of efflorescence /	78
	ettringitte.	
5.31	Cavitated concrete surface.	79
5.32	Arrangement of roofing allows rainwater to drop on the	80
	surface of slab.	
5.33	Kitchen rear area at Block L50.	81
5.34	Disintegrated cement paste and aggregate of concrete	81
	slab at kitchen area of Block L50.	
5.35	Transverse cracks on the drain cover adjacent to Masjid	83
	Sultan Ismail, UTM.	
5.36	Crazing cracks and stains (dark green-colored) on	84
	concrete floor slab at Block C10 level 1.	
5.37	Honeycombed concrete at basement level of Block	85
	M47.	

5.38	Exposed reinforcing steel at basement level of Block M47.	85
5.39	Rehabilitated honeycombed concrete but wasn't done	86
	properly at basement level of Block M47.	
5.40	Honeycombed concrete on soffit slab at basement level	87
	of Block M47.	
5.41	Honeycombed concrete on soffit slab at basement level	87
	of Block M47 (enlarged view).	
5.42	Differential settlement at Block M47 adjacent to TNB	88
	sub-station.	
5.43	Differential settlement at rear elevation of Block M47.	89
5.44	Differential settlement on pathway slab at Kolej 16.	89
5.45	Differential settlement at Block L50.	90
5.46	Differential settlement at Block L50.	90
5.47	Rising Dampness on wall.	92
5.48	Rising Dampness on wall at Block S46.	92
5.49	Rising Dampness on wall at Block L50.	93
5.50	Water falls on railing due to leakage at beam junction.	94
5.51	Staining on railing due to leaking water drops.	95
5.52	Joint failure on upper level of beam junction as shown	95
	in Figure 5.50.	
5.53	Roof joint/sealant failure.	96
5.54	Level 1 Block B08 – Linkway.	96
5.55	Plants well grown in between cracks.	97
6.1	Illustration of cracking mechanism due to overstress in	102
	structural element.	
6.2	The three-stage model of corrosion damage.	114
6.3	Progress of carbonation with time of exposure under	119
	different conditions: (A) 20°C and 65% RH; (B)	
	outdoors, protected by roof; (C) horizontal surface	
	outdoors in Germany. The values are averages for	
	concrete with w/c ratios of 0.45, 0.60, and 0.80, wet-	
	cured for 7 days.	

6.4	Spalling of delamination occurs when expansion of	120
	reinforcing steel due to corrosion begins.	
6.5	Graph shows relationship between corrosion rate and	121
	pH of concrete.	
6.6	Illustration of mechanism of corrosion of	122
	reinforcement.	

APPENDICES

APPENDICES	TITLE	PAGE
А	List of Defective Locations in Kolej Perdana	130
В	List of Defective Locations in Kolej Tun Razak	135

CHAPTER 1

INTRODUCTION

1.1 Introduction

With the advancement of concrete technology, concrete are formed in many ways and in enhanced quality. For instance, precast structures have become prominent in the contemporary construction industry, concrete are pre-prepared in the factory before placing it to the construction site area. Furthermore, nowadays, we can see so many ready mixed concrete suppliers, offering various type of concrete. It has become pleasant and a great helpful system especially when dealing with fasttrack projects. Hence, with rapid growth of its use for structures skeleton or for aesthetic purpose, nobody can help from being surrounded by material named concrete; housing, bridges, dams, roads, offices and even pathways also made from concrete. Some says, it is like living in a concrete jungle era or concrete-age.

However, inevitably, numbers of records have shown that concrete has been experiencing problems in deterioration, cracks, spalling, corrosion and many more to quote here [1, 2, 3, 4]. These problems has become unfavourable and invited unpleasant feeling to the occupants. Seeing this, most of us take some form of acceptance when seeing problems in concrete. Wide variety of concrete problems may result in many bewildering impressions. Are they due to poor workmanship, were non-compliance materials used, construction errors or perhaps design errors? In fact, there are a lot more of reasons why concrete becomes problematic. Therefore, decisions to overcome concrete problems can be started using heuristics to deal with bounded rationality of such why the problem occurred in the first place. Systematic errors can result in from use of an incorrect heuristic and the errors, for sure, will appear over and over since the rule used to make decision is flawed from the onset.

Henceforth, engineers may have to learn and understand the behaviour of the concrete problems before implying any repairing methods and learn from the successful implemented solutions done by others before this. Otherwise, time, money and efforts, will be wasted for using wrong implication and heuristic. Therefore, a research should be conducted to get the right implication and heuristic. Nobody should imply solution if there is lacking of complete information on the intended-for-research concrete. Hence, investigations may have to be carried out on certain parameters such as the proportion of the mix, criterions applied to calculate concrete mix, types of supervision during construction; were the materials inspected before use, were the concrete poured complying with the design mix, and many more approaches to get the right implication and heuristic.

Using the above philosophy, a research on concrete problems in UTM ought to be conducted in obtaining the right repairing methods or at least as a general reference tool before doing any construction works.

However, the research in this paper is not about repairing methods but merely a case study research on concrete problems related to durability; investigate and identify concrete problems including locations where they might be, and classify its symptoms to probable causes where in here appropriate preventive measures and repairing methods can be suggested. Still, it is not about repairing methods.

1.2 Research Background

As mentioned previously, concrete problems are so common and yet, there are numerous types of concrete problems that can be inserted in the list if any.

Noticeably, there are many types of concrete problems in UTM such as cracks, deteriorated and abraded concrete; probably due to chemical attack, construction errors, design errors etc. This has brought the interest to conduct a research on type of concrete problems in the vicinity of Universiti Teknologi Malaysia, Skudai (UTM).

Having this in mind, it is a need that a research on concrete problems in UTM may have to proceed with limitation on its durability aspect due to the fact that concrete problems is an extremely complex subject. It differs from one to another due to different site attributes. Few examples of concrete problems in UTM are shown in Figure 1.1, Figure 1.2 and Figure 1.3:-



Figure 1.1: Figure depicts concrete have been severely eroded and start spalling.



Figure 1.2: Figure depicts pathways slab transversely cracking.



Figure 1.3: Figure depicts apron slab start cracking and surface is abraded.

1.3 Research Objectives

The objectives of the research can be short listed as follows:

- (i) To conduct a study on concrete problems occurring in UTM.
- (ii) To classify the concrete problems and its causes using *initial failure* hypothesis (IFH) method [5].
- (iii) To relate the concrete problems in UTM to the durability aspect of concrete.

1.4 Scopes of Research

The scope of research shall be in line with the concrete problems in durability aspect. Its huge built area encompasses faculties' buildings, residential buildings, library, and facilities buildings such as sports complex, food courts, mosque, banks, student affairs buildings, and administration centre. These buildings and its surroundings shall be the areas where all the data will be sourced out.

During the process of gathering raw data, all types of problems will be recorded and illustrated. Screening and scrutinizing will be carried out to classify the problems prior getting into the main study that is durability problem of concrete, which will be discussed in the Chapter 4, where it presents a logical method for relating the symptoms or observations to the various causes.

In addition, the study is also intended to establish diagnoses on concrete problems in initial failure hypothesis form. The cause or causes for the deterioration of concrete, such as crack problems will be diagnosed and related to common problems that can occur anywhere, anytime in the field of construction site due to the lack of precautions or steps taken to ensure that the concrete was satisfactorily complied in accordance with the requirements of relevant standard.

Finally, all the interpreted and analyzed data will be tabulated in a table form, showing type of problems, weightage by numbers and percentage, and locations

where problems occurred. These data can be used to relate its symptoms to causes of the problem where it may suggest solutions and preventive measures to avoid repetitive problems in the future. In addition, it is hoped that the information from this study can be useful as a preliminary reference to construction players prior executing any construction works or repairing works in the future prospect of the Malaysian construction industry.